


ISSUE: Cylinder head or block surfaces may be distorted, rough, or corroded, leading to poor sealing.

Ensure the cylinder head and engine block surfaces have been checked, ensuring level sealing surfaces.

Maximum values: Roughness <math>< 15\mu\text{m}</math> & Distortion <math>< 0.03\text{mm}</math> per 100mm

Head and block surface must be free from debris and corrosion, particularly around the cooling system passage ways.

The cylinder head bolt threads in the cylinder block must be cleaned with a thread tap and new head bolts used if specified.

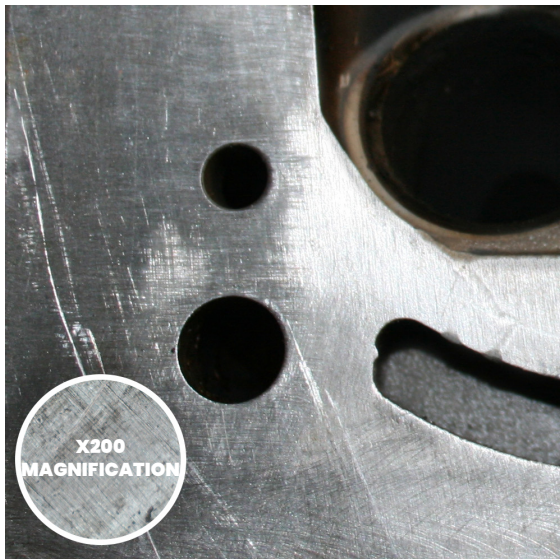

INCORRECT



CORRECT



DO NOT USE ANY ADDITIONAL SEALING COMPOUND. ALL GASKETS MUST BE FITTED DRY.

FAI products are designed for use in standard, unmodified vehicles and are not intended for custom or altered applications. All components must be installed by a qualified technician.

Please note: FAI products are supplied without fitting instructions.

For more information, email technical@faiauto.com

faiauto.com